

CorvetteRadios.Com

Your Delco Cd & Bose Speaker Amplifier Repair



We Have the Unlock Codes for your radio

1990 and Up models

Refer to illustrations 15.11, 15.13, 15.17 and 15.19


Radio control

- 10 Disconnect the cable from the negative terminal of the battery. If equipped with airbags, disable the airbag system (see Section 30).
- 11 Remove the console trim plate (see illustration).
- 12 Remove the two screws retaining the center air outlet and remove the outlet.
- 13 Remove the screws from the accessory trim plate to instrument panel and remove the trim plate (see illustration).
- 14 Remove the right side console screws to the instrument panel.

- 15 Remove the screw on the right side of the driver information center to the upper trim panel.
- 16 Relocate the trim panel and pad to access the right hand radi control screw and remove the screw.
- 17 Remove the two screws holding the radio control to the instrument panel then slide the radio control out far enough to disconnect the electrical connector then remove the radio control (see illustration).
- 18 Installation is the reverse of removal.


Radio receiver

- 19 The radio receiver is located in the right rear cargo compartment and is held in place with Velcro fasteners (see illustration).

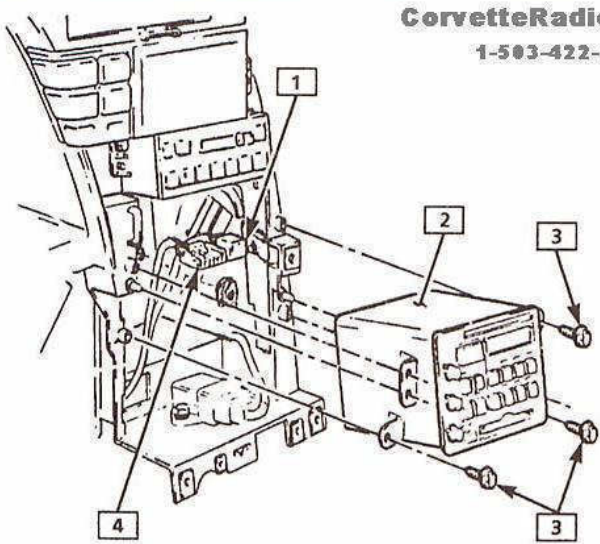

15.17 Radio control mounting details - 1990 and later models


- | | |
|------------------------------------|--------------------------------------|
| 1 Radio receiver harness connector | 3 Bolts |
| 2 Radio control | 4 Instrument panel harness connector |

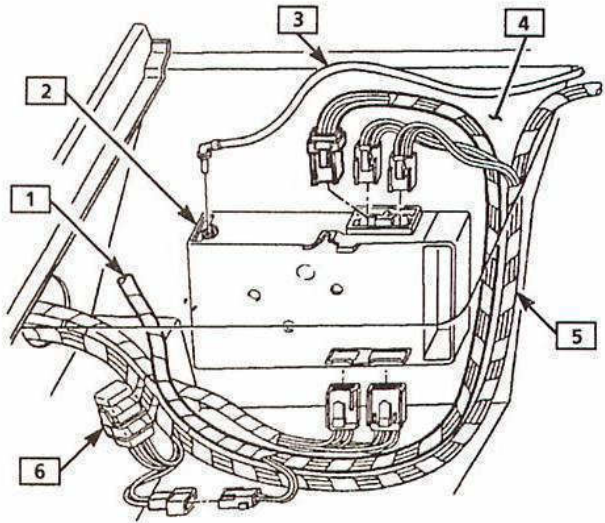

15.19 Radio receiver mounting details - 1990 and later models

- | | |
|---------------------------|----------------------------------|
| 1 Front body harness | 4 Right rear storage compartment |
| 2 Radio receiver | 5 Speaker harness |
| 3 Antenna extension cable | 6 Amplifier relay |

Delco Radio Display Bulbs
10ea For \$16 + S&H

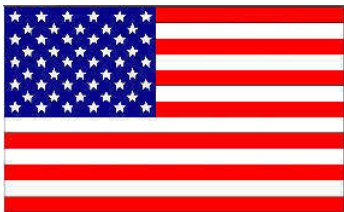

GM Bose & Non Bose
CD Mechanism Repairs

Bose Speaker Amplifier \$85 + S&H
CDM Repair \$110 +S&H